SIEMENS

LITHOSTAR Modularis

CS

Service Instructions SP011/02/I

Title: Fuse F5 of the cooling unit

Reason for update:

☒ Infrequent Service

Urgency:	☐ Immediate	☒ Within	12 months
Update material required?	☒ Yes	☐ No	
Materials free of charge?	☐ Yes	☒ No	
Return of parts?	☐ Yes	☒ No	
Estimated completion time:	0.5 h	Number of CSE's: 1	
Customer application training?	☐ Yes	☒ No	

Systems/Products affected/System identifying IVK

Name	Material No.	Serial No.
LITHOSTAR Modularis	55 31 103 J1048	01001 - 01156

Remark: n.a.

Components affected/to be modified

Name	Material No.	Serial No.	Component status Affected
n.a.	n.a.	n.a.	n.a.

Remark: n.a.

Chg. Ref. No.: 116 880
Name: Erlwein
Dept.: CS PS 24

© Siemens AG 2002
The reproduction, transmission or use of this document or its contents is not permitted without express written authority. Offenders will be liable for damages. All rights, including rights created by patent grant or registration of a utility model or design, are reserved.

Print No.: SPL1-130.898.02.01.02 Doc. Gen. Date: 09.02

Replaces: n.a. Version 2.0; August 1, 2002

Document Revision Level

This document corresponds to the version/revision level effective at the time of system delivery. Revisions to hardcopy documentation are not automatically distributed.

Please contact your local Siemens office to order current revision levels.

Disclaimer

The installation and service of equipment described herein is to be performed by qualified personnel who are employed by Siemens or one of its affiliates or who are otherwise authorized by Siemens or one of its affiliates to provide such service.

Assemblers and other persons who are not employed by or otherwise directly affiliated with or authorized by Siemens or one of its affiliates are directed to contact one of the local offices of Siemens or one of its affiliates before attempting installation or service procedures.

Systems/Products Affected

All LITHOSTAR Modularis systems from serial number 01001 - 01156.

Reason for the Update

Depending on the line voltage or the line frequency it can happen that the fuse F5 of the cooling unit on board D1 responds when the system is switched on.

Prerequisites

n.a.

Special Tools / Documents

n.a.

Ordering Information

The following update kit has to be ordered via CSML (SAP Distribution Channel factory 2050) or BU Logistics (factory BU) (only with an order via BU Logistics):

Update Kit 11 56 640

Contents of the Update Kit

Update kit **11 56 640** contains the following parts:

Pos.	Quan.	Material No.	Name
1	1	30 90 859	1.6A 250V FTT fuse
2	1	34 14 000	Label

Tab. 1

Work Steps

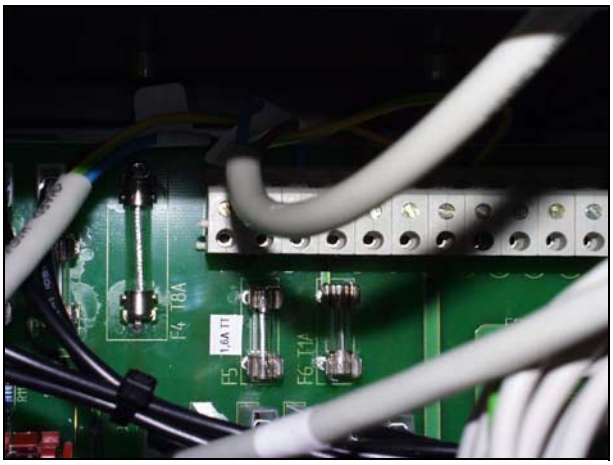

Fig. 1

- Switch the system off and pull out power plug.
- Remove the covers.
- Remove defective fuse from board D1.
- Cover the fuse value printed on the board with a new label.
- Insert new 1.6A FTT fuse.
- Reattach covers.

Final Check

- Check the function.

Customer Information

n.a.

Final Work Steps

- Update the system documentation.
  Update the revision level, the operating instructions and the technical documentation. Fill out, and if needed, make a copy of the attached "Completion Protocol/ Update Completion Form" and file it in the corresponding System Binder/User Handbook.
- Updates that have already been completed prior to publication of this SI must also be reported.
- The update is reported as follows:
  - The modification reply cards (Type 606) previously distributed with the publication of updates no longer apply.
  - The modification reply report has to be prepared by authorized personnel using an application on the Intranet.)

Completion Protocol / Update Completion Form

The update with the number **SP011/02/I** has been completed.

Material number: 53 31 103 J1048

Serial number: .....

Customer: ..... Site: .....

Customer No.: .....

Name (CSE): ..... Telephone: .....

Country: ..... Location: .....

Date: ..... Signature: .....

Remark: .....

.....

NOTE	**After completing the update, make a copy of this page, fill it out and file it in the corresponding System Binder/User Handbook.**